


www.dewesoft.com - Copyright © 2000 - 2024 Dewesoft d.o.o., all rights reserved.

# Reference Curves For Signal Comparison

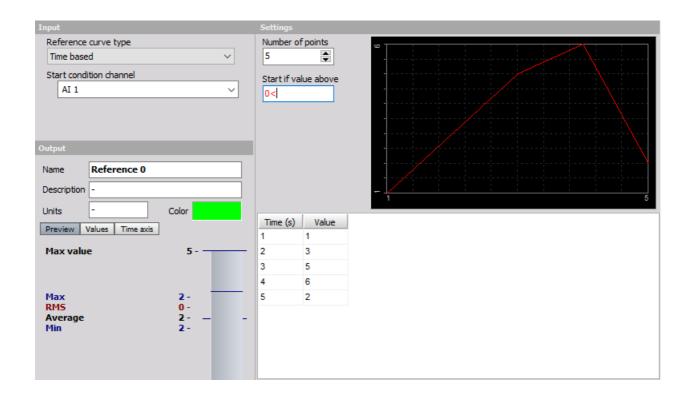

### What is a Reference curve?

The reference curve is defined by a user. With the reference curves, we can *compare different types of signals* (time domain, frequency domain) to the reference signal and see whether our signal is above or below the reference limit.

Available reference curves in <u>Dewesoft X</u> are:

- time reference curve,
- XY reference curve,
- frequency domain reference curve, and
- **vector** reference curve.

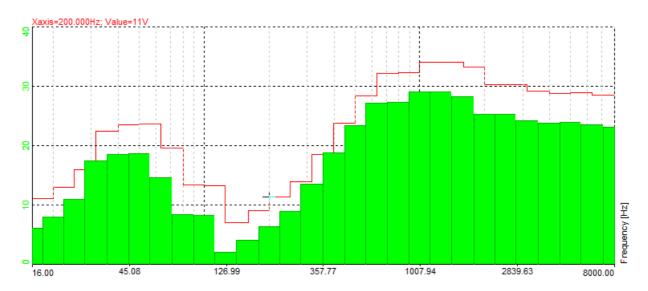


Image 1: Reference curve example

#### When the Time reference curve is used?

With **Time reference curve** we *define the reference curve in the time domain, displayed on the recorder*. The time reference curve is *used for monitoring the time domain data*. The time reference curve can be added under math functions **Add math -> Time reference curve**.

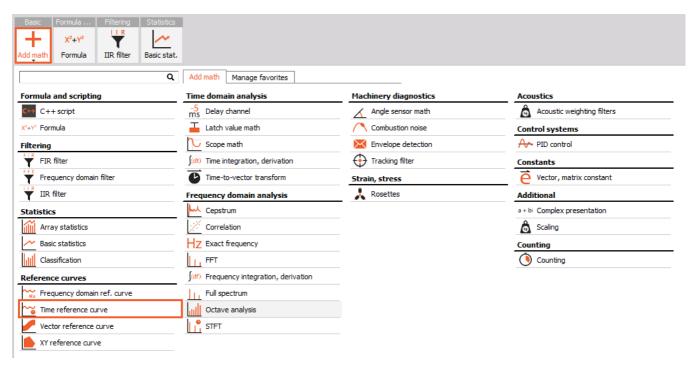


Image 2: Add the Time reference curve

#### Time based Reference curve

The **Time based reference curve** is useful for *defining a curve in time as a reference during a certain test*, which has to **follow a certain protocol**. Let's say we have a test where we need to accelerate to 100 km/h in 10 seconds, drive constantly for 10 seconds, and decelerate to 0 km/h in 10 seconds.

We can define each curve starting criteria. If the **Start condition channel** is not defined, the curve will start at the beginning of the measurement. Maybe it would be nice to define the start of the test on a channel that measures vehicle velocity, but then we have to define the limit on which the measurement will Start if value is above (this field appears only when Start conditional channel is selected - default = ). In our example, we could enter for example 2 km/h.

The next step is to define the **Number of points** and the points themselves in the list. In our case we would have four points, so we enter this in the field.

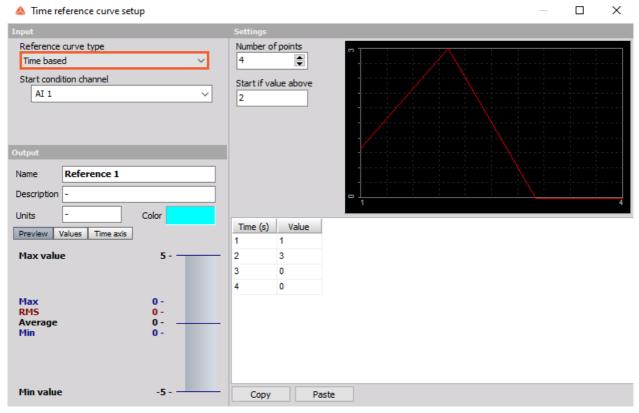


Image 3: Time based reference curve

## Single value based Reference curve

A single value based reference curve can be understood as a *sort of non-linear scaling*. We need to define a **First reference** channel, **Number of points**, and a **table** with the *values of reference and output channel*.

So in the example on image 4, if the input channel will be 3, the output value will be 5. The values will be interpolated in between the points. So if the input is 2.5, the output will be 3.5. If the value is below or above the lowest or highest point, data will be extrapolated from the two lowest or highest points. If we have 0 at the input, we will have 0 at output. If we have 5 at the input, we will have 11 at the output.

On the upper right, you will have previewed diagram of your inputs.


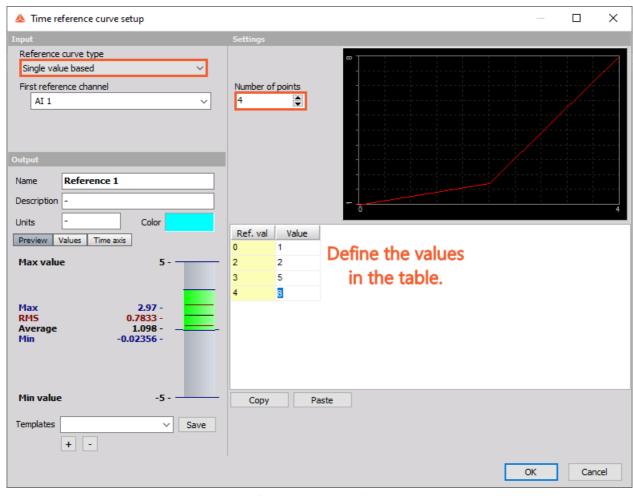


Image 4: Single value based reference curve

"Single value based" option was removed from Time reference curve setup from Dewesoft X3 SP12 - Release notes. Substitute is to use Scaling math and configure "Input value" column as "Ref. value" column in old setup.

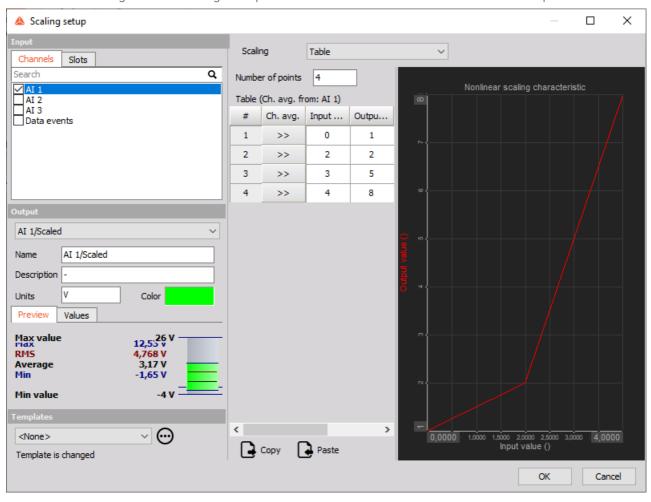

#### Dual value based Reference curve

**Dual value based reference** curve has *two inputs:* **First reference channel** and **Second reference channel**. We can imagine as the tridimensional surface of reference points X and Y are two reference channels while the Z is defined points. We need to define first the channels and the **Number of points** for each channel.

Then we need to enter the reference values in the list. Display on the right upper part if the Reference curve setup window now shows the curve.

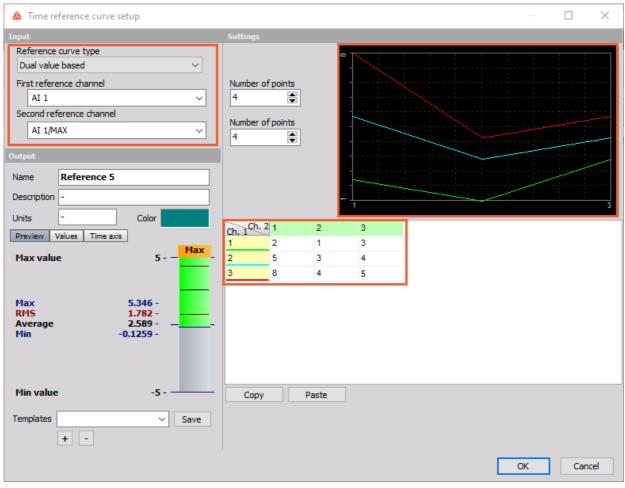


Image 5: Dual value based reference curve

A good example of using a dual reference curve is to define the limit oil pressure referenced to RPM and the oil temperature.

#### From data file Reference curve

The time reference curve can be imported from another data file.

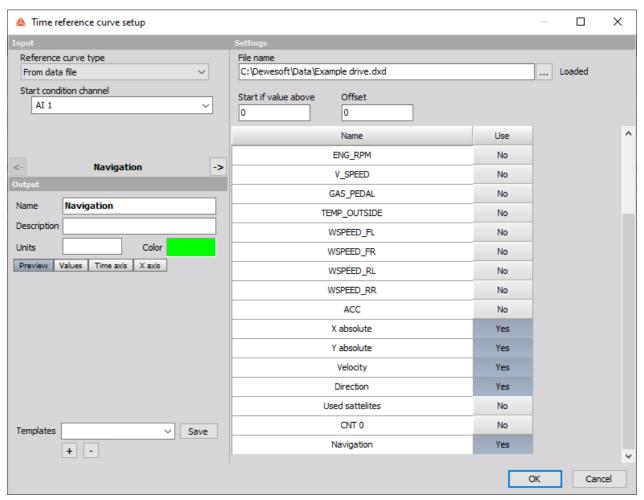


Image 6: Reference curve From data file

### Example I: Time Reference curve

Let's say we have a test where we need to accelerate to 100 km/h in 10 seconds, drive constantly for 10 second and decelerate to 0 km/h in 10 second.

In our example, we can enter the start condition for example 2 km/h. The table below shows how our vehicle should behave.

Point number	Time [s]	Velocity [km/h]
1st	0	2
2nd	10	100
3rd	20	100
4th	30	0

The next step is to define the number of points and the points themself. In our case, we have 4 points.

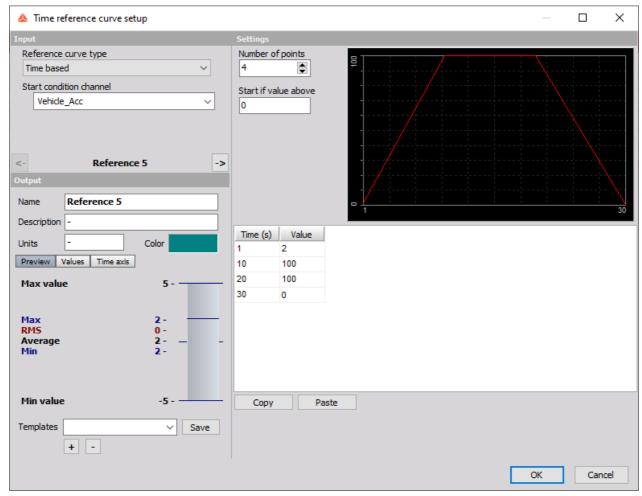


Image 7: Define the number of points and the points themself

We can display our time reference curve on the recorder. Then we can use the **Formula Math channel**, to see if we are above or under our reference:

This formula will give you a value of '1' if our signal from the *vehicle is above the reference curve* and '0' if our *real signal is below the limit*.

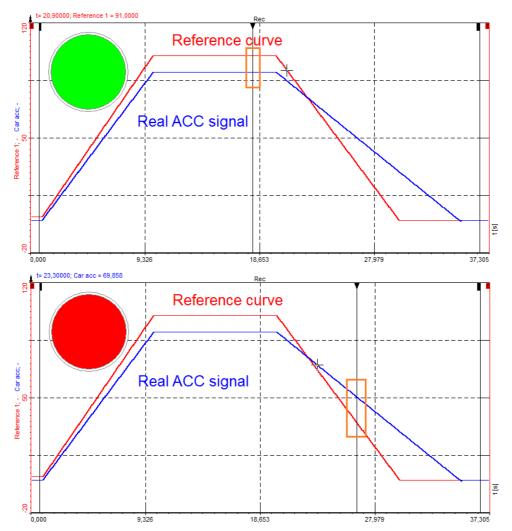


Image 8: Monitoring point will change its color as the real signal will go above the reference curve

#### When the XY Reference curve is used?

The **XY reference curve** math module *provides the reference curve for the XY recorder*. The XY reference curve can be added the same as the Time reference curve was, under **Add math -> XY reference curve**.

When you open the setup for the XY reference curve, the window shown on image 9 will open.

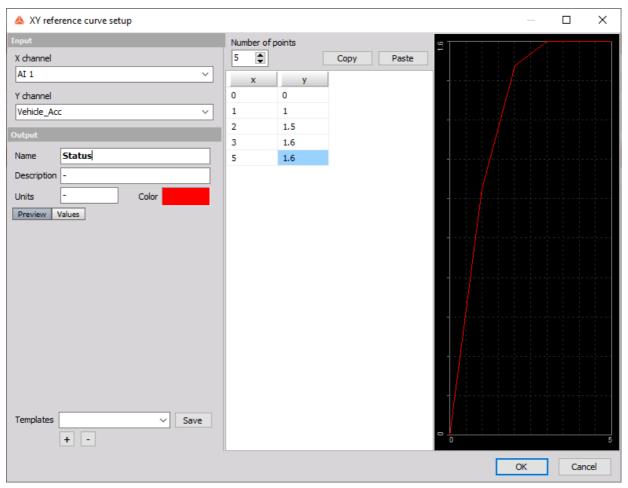


Image 9: XY reference curve setup

After choosing the **input channels for the X and Y channel**, we need to set the **number of points** for the XY reference curve. The reference points can be *entered value by value or transferred with the* **copy-paste** *function*. Copy button copies all the points to the clipboard in a tab-delimited style, so it can be easily pasted to any spreadsheet software. Also, the values can be copied from other spreadsheets with the Paste command, where the data has to be tab-delimited and each line should be terminated with carriage return/line feed character.

For example in the following picture of MS Excel, we chose the data range and selected Copy, afterward, the data can be easily pasted into <u>Dewesoft X</u>.

Number of points		U23		Ĭ : L	
5	L	Copy Paste	4	Α	В
X	у		1	X	Υ
0	0		2	0	0
1	1		3	1	1
2	1.5		4	2	1,5
3	1.6		5	3	1,6
5	1.6		6	5	1,6

Image 10: Easily Copy-Paste values to, or from MS Excel

There is another advantage of the reference curve. The **output channel** (*Status* in our case) **gives a value of 1** *when the XY curve crosses the reference curve.* This can be used for *trigger criteria* or for *counting of events* (with ECNT function in formula editor).

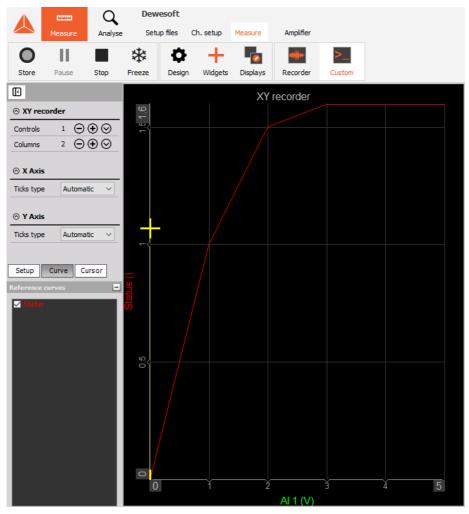


Image 11: The output channel gives a value of 1 when the XY curve crosses the reference curve

### Example II: XY reference curve

In the example below, we have *two Eddy current proximity probes that measure proximity*. While placing the probes around the shaft, we can see the movement of the shaft. In the reference curve setup, we defined the rectangular, with maximum allowed movement.

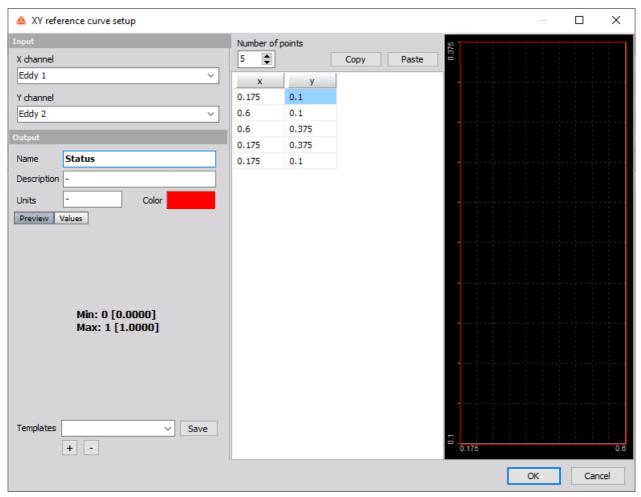


Image 12: Define the rectangular with maximum allowed movement

With displayed XY reference curve in the XY recorder, we can monitor the movement of the shaft and if it stays inside the allowed borders

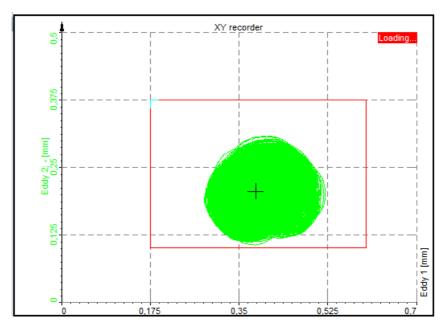


Image 13: Monitoring the shaft movement

### How to use the FFT Reference curve?

The **FFT reference curve** math module *provides the reference curve for the FFT display*. It can be used for *displaying the reference on FFT screen* and also to provide a math output channel which goes high when the levels are exceeded.

FFT reference curve can be added under the Math section, Add math -> Frequency domain reference curve.

In the channel setup, we define the maximum number of lines, window type, and overlap.

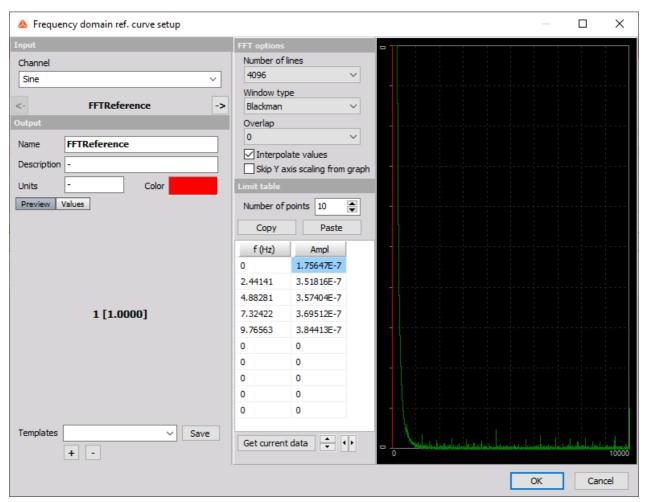


Image 14: FFT reference curve

These values will be used for the calculation of the FFT spectrum. Then we define the limits - limit table. They can be entered value by value or from current data.

**Get current data** means that current FFT (in the setup screen) will be taken as the reference. We can define some *offset to that reference* (with up/down and left/right arrows button). Similar to the FFT trigger it will raise/widen the current transfer curve.

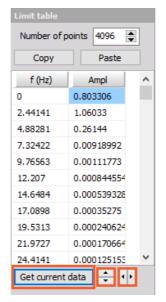


Image 15: Get current data

The FFT reference curve can be used in FFT display to show some reference lines, while the output channel (named Status in the screenshots) can be used for displaying either if the current data is above or below the defined reference.

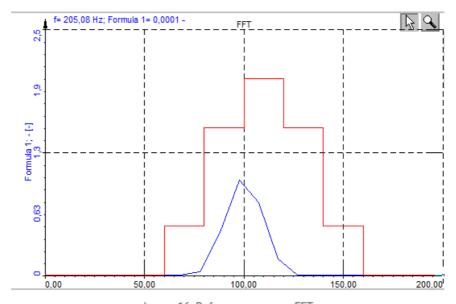


Image 16: Reference curve on FFT

### Example III: FFT domain Reference curve

Let's take an example of using the tuning fork. With the reference curve, we can check if the tuning forks are working correctly. The frequency of tuning fork is approximately 440 Hz. We create a reference curve, with allowed amplitude and frequency range.

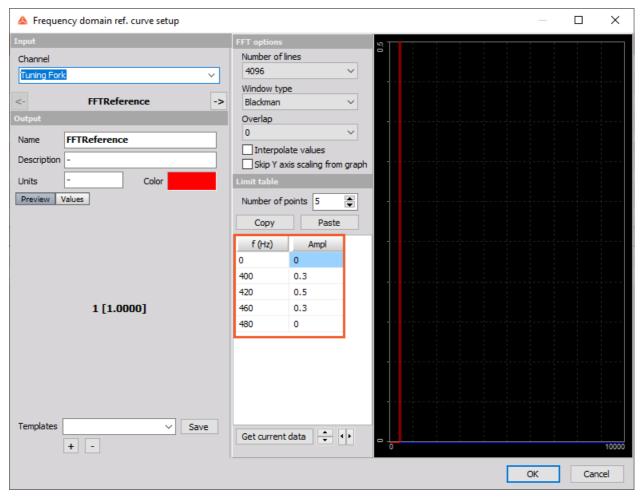


Image 17: Create a reference curve, with allowed amplitude and frequency range

We add an FFT display, select the channel (Tuning fork) and display the FFT reference curve. The FFT reference curve can be obtained during the measurement, with the **Get current** data option.

During the measurement, we can also observe the time signal on the recorder and the FFT of the signal as it is shown on image 18. If the FFT signal from the tuning fork (green) is under the FFT reference curve (red) we can conclude that the tuning forks are working properly.

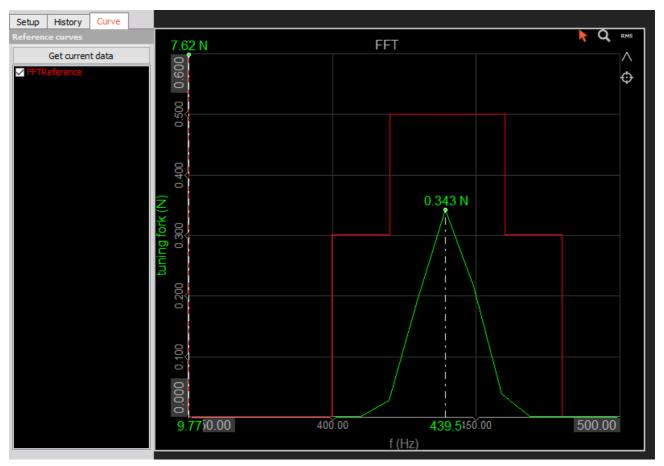


Image 18: Preview the FFT diagram of tuning forks and apply the FFT reference curve

#### How to make a Vector Reference curve?

In vector reference curve we define the reference curves for the input channel, which is usually an array (FFT data, ...).


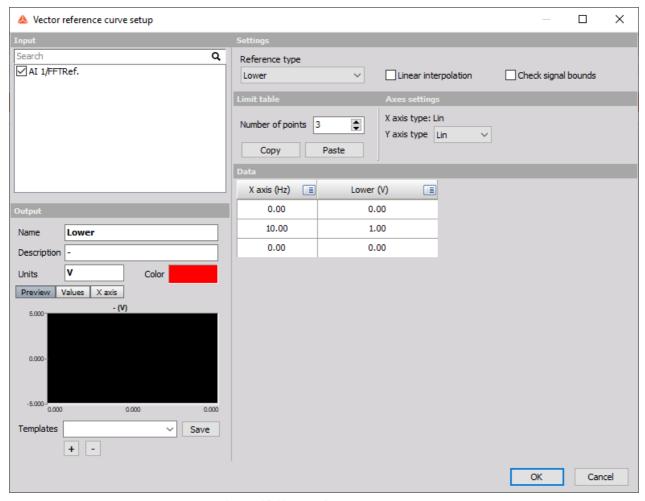


Image 19: Vector reference curve setup

The **reference curve type** can be selected from:

- lower (define the lower limit),
- upper (define the upper limit), and
- lower & upper (define the lower and upper limit).

With **linear interpolation**, the program will draw a direct line between the two neighborhood points. It will give a smoother transition between points on the curve.

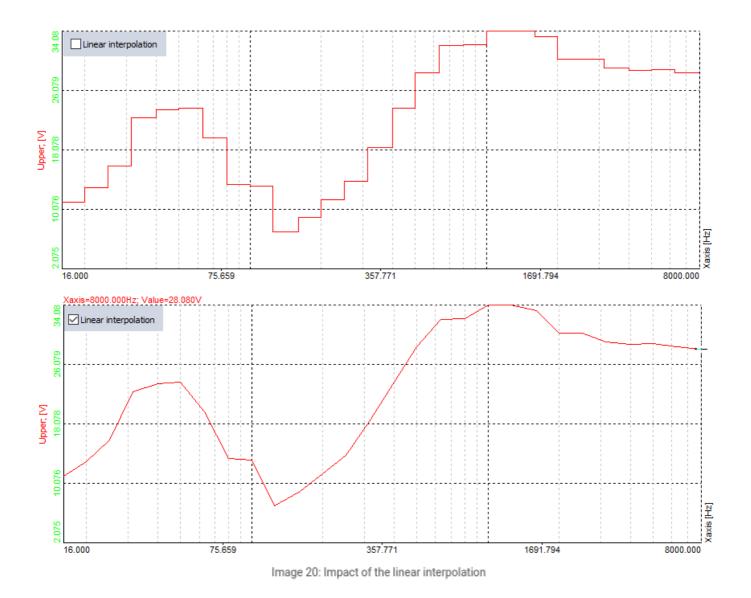

**Check signal bounds** will create an additional output channel which will output '1' when the input is higher than the reference curve and will output '0' when the input is below the reference curve

**Axes settings** can be selected from:

- linear,
- logarithmic,
- 0 dB (dB reference will be set from the range of the first channel),
- Noise dB (the reference value is 20 uPa), and
- ref. dB (user enters the reference value).

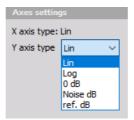


Image 21: Axes settings

Next, we **define the points** in the limit table. We can define the points manually or copy/paste if from an external program.

Rename the channels with the click on the icon in the top right corner and selecting the **Change axis name/unit** option.

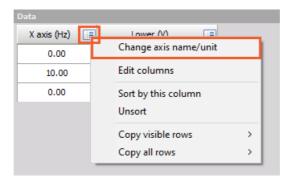


Image 22: Change names

When we paste the data from an external program (e.g. Excel) we have to be careful to write the right names for the axis.

### Example IV: Cylinder pressure Reference curve

Create a reference curve math with add Math -> Vector reference curve.

Open the **settings** for the vector reference curve and **select the channel that will be used for checking the level** - we use CylPressure.

**Linear interpolation** will give a smoother transition between points on the curve. **Check signal bounds** will create an *additional output channel* which will output 1 when the input is higher than the reference curve and will output 0 when the input is below the reference curve.

The reference curve is defined with a table. The first column is the crank angle (X) axis, and the second column the amplitude of the reference (Y) axis. In this first example, we have defined only two points with a value of 41 (bar).

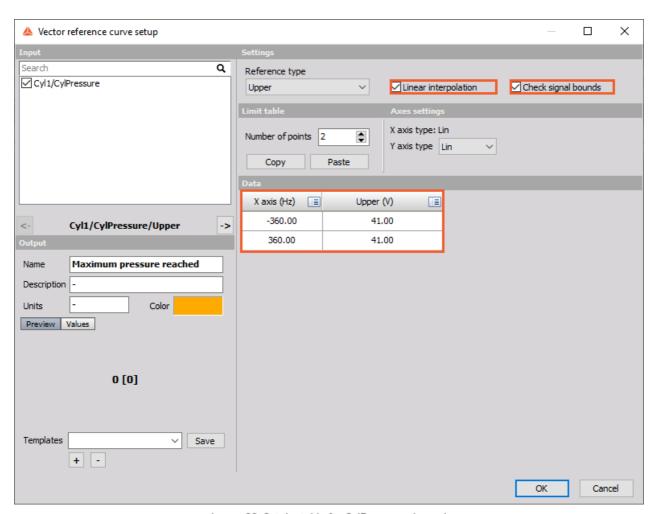


Image 23: Set the table for CylPressure channel

We have added a CA scope and selected the cylinder pressure signal and reference curve for display. An indicator lamp was also added and the output channel from the vector reference curve assigned to it. When the pressure is above the reference curve the indicator lamp will turn red, otherwise, it stays green. The output from the channel goes from 0 to 1, when the reference axis is crossed.

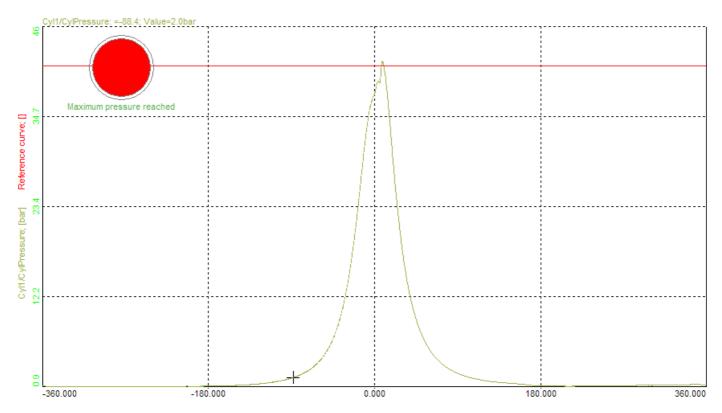


Image 24: Monitoring CEA scope with cylinder pressure signal and the reference curve - Maximum pressure was reached

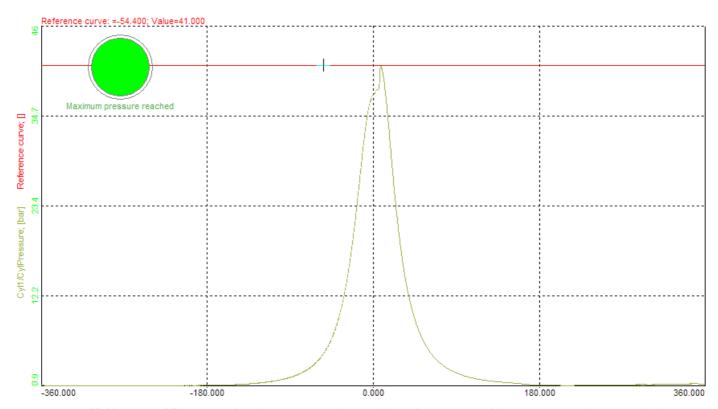


Image 25: Monitoring CEA scope with cylinder pressure signal and the reference curve - Maximum pressure is not reached yet

We can modify the simple reference curve. It is also very easy to create a reference curve from a recorded pressure signal. For this, we need some datafile with the pressure signal that will be used as a reference.

First, we add **Basic statistics** inside the Math section.

We open the basic statistics setup and select the pressure channel from the combustion analysis module (combustion analysis must be added in order to have a crank-angle domain instead of time-domain). **Maximum** should be selected to get the maximum value of all the cycles and under calculation type time based and **single value**.

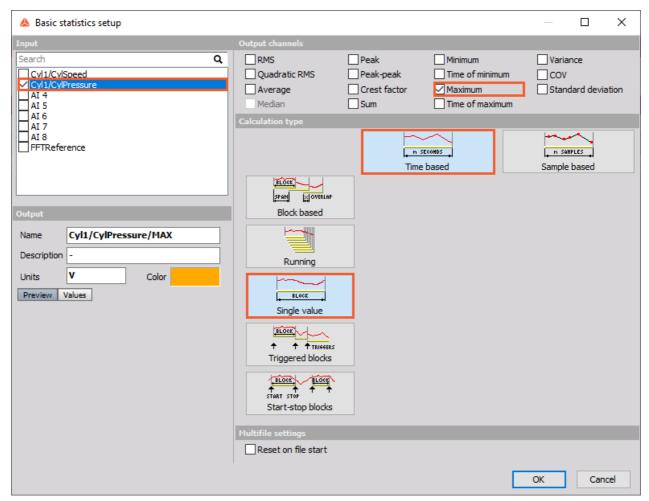


Image 26: Setup the basic statistics

When we add this new channel on the CA scope we see that we get the maximum value of pressure from all the cycles.

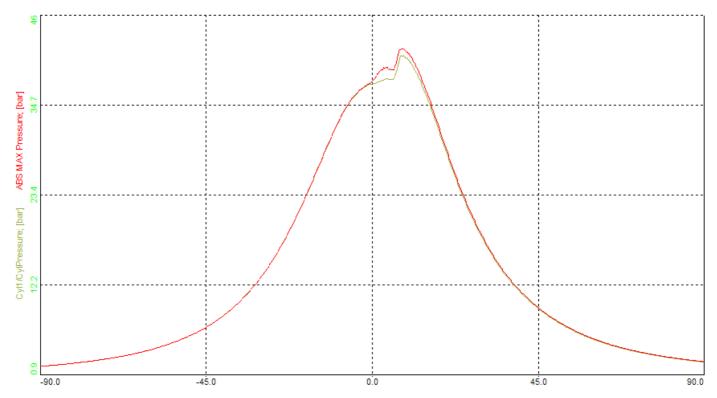


Image 27: On the CEA scope you are able to see the maximum value of pressure from all the cycles

Now we need to *make an offset curve* that will be used as a **trigger**. As an example, we will make a *curve that will trigger the* vector reference curve output channel when the maximum pressure is above 110%.

We create a new **formula** in the Math module where we multiply the previous basic statistics channel with 1.1.

#### 'ABS MAX Pressure'\*1.1

The next step is to display only the last created formula on the CEA scope and copy the data to the clipboard.

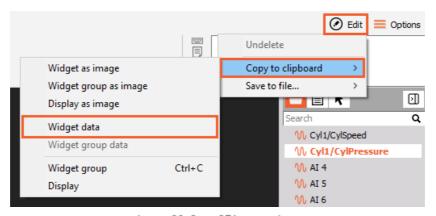


Image 28: Copy CEA scope data

We open again the vector reference curve setup and simply paste the values.

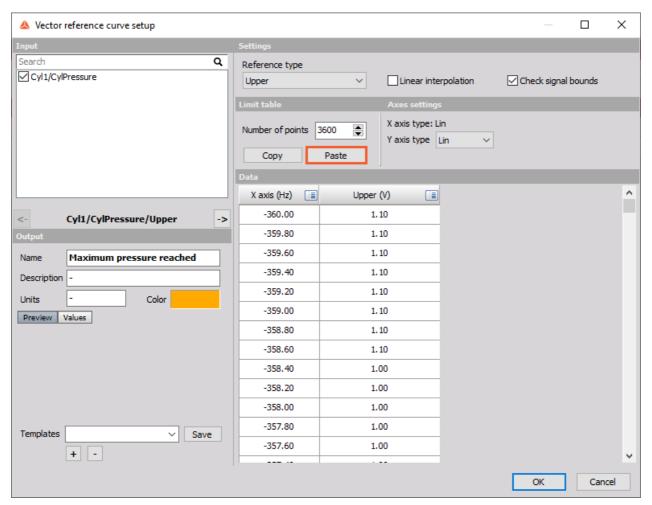


Image 29: Paste CEA scope data as the vector reference curve

It is also possible to reduce the number of points for the **reference curve in Excel**.

Copy the data to excel and use the formula =OFFSET(Sheet2!A\$1,(ROW()-1)\*100,0) to output only every 100th line. This will make modifying the refence curve much easier since there will be only 37 points left instead of 3600.

A -360 359.8 359.6 359.4 359.2 -359 358.8 358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357	B 1.1 1.1 1.1 1.1 1.1 1.1 1.1 1.1 1.1 1.	C	D	E -360 -340 -320 -300 -280 -260 -240 -220 -180 -160 -140 -120	F 1.1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	G	Н		J
359.8 359.6 359.4 359.2 -359 358.8 358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1.1 1.1 1.1 1.1 1.1 1.1 1.1 1 1 1 1 1 1			-340 -320 -300 -280 -260 -240 -220 -200 -180 -160 -140	1 1 1 1 1 1 1 1 1 1 1				
359.6 359.4 359.2 -359 358.8 358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1.1 1.1 1.1 1.1 1.1 1.1 1 1 1 1 1 1 1			-320 -300 -280 -260 -240 -220 -200 -180 -160 -140	1 1 1 1 1 1 1 1 1 1				
359.4 359.2 -359 358.8 358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1.1 1.1 1.1 1.1 1.1 1 1 1 1 1 1 1			-300 -280 -260 -240 -220 -200 -180 -160 -140	1 1 1 1 1 1 1 1 1.1				
359.2 -359 358.8 358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1.1 1.1 1.1 1.1 1 1 1 1 1 1 1			-280 -260 -240 -220 -200 -180 -160 -140	1 1 1 1 1 1 1				
-359 358.8 358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1.1 1.1 1.1 1 1 1 1 1 1 1 1			-260 -240 -220 -200 -180 -160 -140	1 1 1 1 1 1.1				
358.8 358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1.1 1.1 1 1 1 1 1 1 1 1			-240 -220 -200 -180 -160 -140	1 1 1 1 1.1				
358.6 358.4 358.2 -358 357.8 357.6 357.4 357.2 -357	1.1 1 1 1 1 1 1 1 1			-220 -200 -180 -160 -140	1 1 1 1.1				
358.4 358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1 1 1 1 1 1 1			-200 -180 -160 -140	1 1 1.1				
358.2 -358 357.8 357.6 357.4 357.2 -357 356.8	1 1 1 1 1 1			-180 -160 -140	1.1				
-358 357.8 357.6 357.4 357.2 -357 356.8	1 1 1 1 1			-160 -140	1.1				
357.8 357.6 357.4 357.2 -357 356.8	1 1 1 1			-140					
357.6 357.4 357.2 -357 356.8	1 1 1				1.2				
357.4 357.2 -357 356.8	1 1 1			-120					
357.2 -357 356.8	1			120	1.4				
-357 356.8	1			-100	1.8				
356.8				-80	2.6				
	1			-60	4.5				
256.6	_			-40	9.3				
356.6	1			-20	23.4				
356.4	1			0	41.4				
356.2	1			20	32.2				
-356	1			40	12.6				
355.8	1			60	5.9				
355.6	1			80	3.4				
355.4	1			100	2.3				
355.2	1			120	1.8				
-355	1			140	1.5				
354.8	1			160	1.3				
354.6	1			180	1.1				
354.4	1			200	1				
354.2	1			220	1				
-354	1			240	1				
353.8	1			260	1.1				
353.6	1			280	1.1				
353.4	1			300	1.1				
353.2	1			320	1.2				
-353	1			340	1.2				
	1			360	1.1				
	354.8 354.6 354.4 354.2 -354 353.8 353.6 353.4 353.2 -353	354.8 1 354.6 1 354.4 1 354.2 1 -354 1 353.8 1 353.6 1 353.4 1 353.2 1 -353 1 352.8 1	354.8 1 354.6 1 354.4 1 354.2 1 -354 1 353.8 1 353.6 1 353.4 1 353.2 1 -353 1 352.8 1	354.8 1 354.6 1 354.4 1 354.2 1 354.2 1 353.8 1 353.6 1 353.2 1 353.2 1 353.2 1 352.8 1	354.8 1 160   354.6 1 180   354.4 1 200   354.2 1 220   -354 1 240   353.8 1 260   353.6 1 280   353.4 1 300   353.2 1 320   -353 1 340   352.8 1 360	354.8 1 160 1.3   354.6 1 180 1.1   354.4 1 200 1   354.2 1 220 1   -354 1 240 1   353.8 1 260 1.1   353.6 1 280 1.1   353.4 1 300 1.1   353.2 1 320 1.2   -353 1 340 1.2   352.8 1 360 1.1	354.8 1 160 1.3   354.6 1 180 1.1   354.4 1 200 1   354.2 1 220 1   -354 1 240 1   353.8 1 260 1.1   353.6 1 280 1.1   353.4 1 300 1.1   353.2 1 320 1.2   -353 1 340 1.2   352.8 1 360 1.1	354.8 1 160 1.3   354.6 1 180 1.1   354.4 1 200 1   354.2 1 220 1   -354 1 240 1   353.8 1 260 1.1   353.6 1 280 1.1   353.4 1 300 1.1   353.2 1 320 1.2   -353 1 360 1.1	354.8 1 160 1.3   354.6 1 180 1.1   354.4 1 200 1   354.2 1 220 1   -354 1 240 1   353.8 1 260 1.1   353.6 1 280 1.1   353.4 1 300 1.1   353.2 1 320 1.2   -353 1 340 1.2   352.8 1 360 1.1

Image 30: Reference curve from MS Excel